
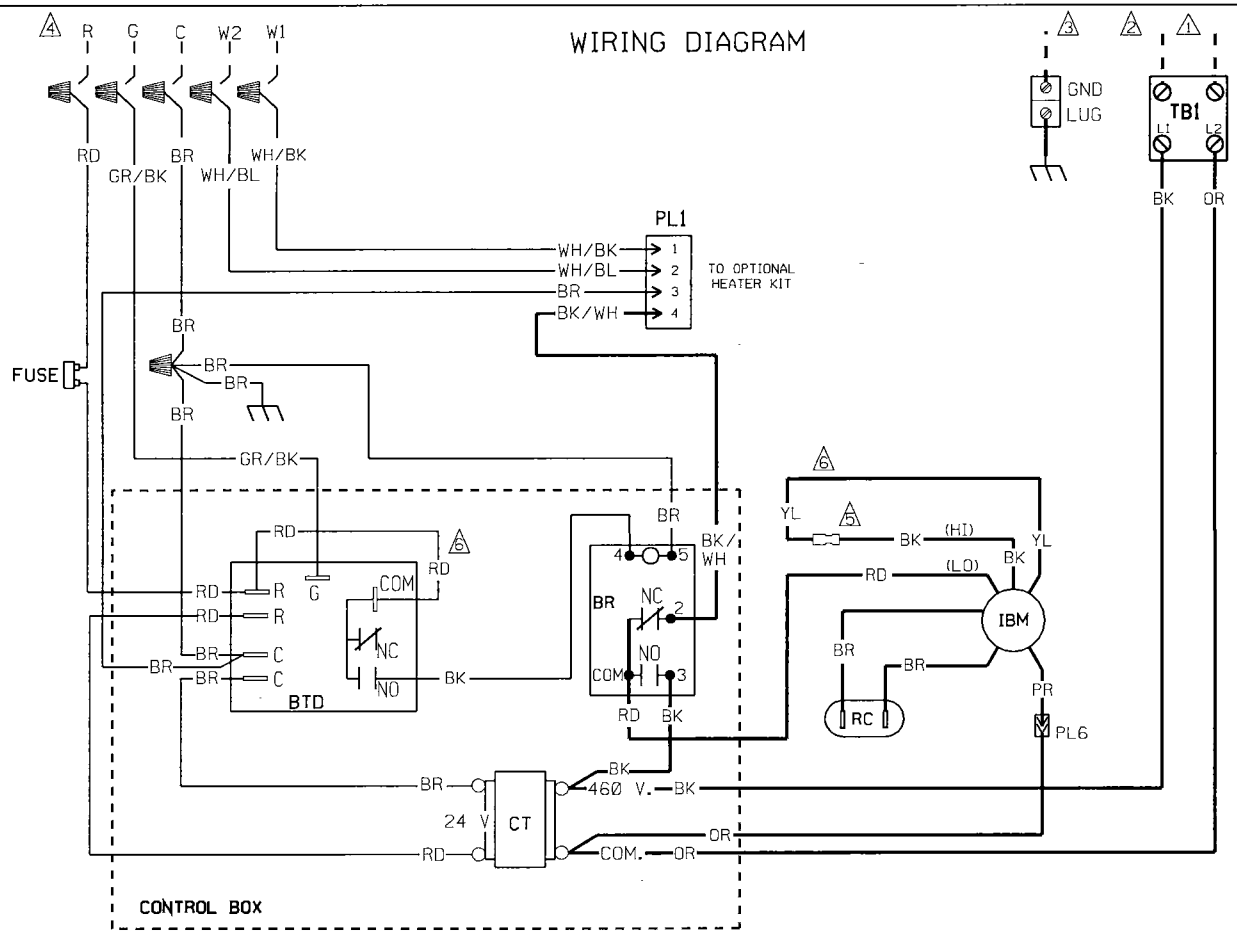


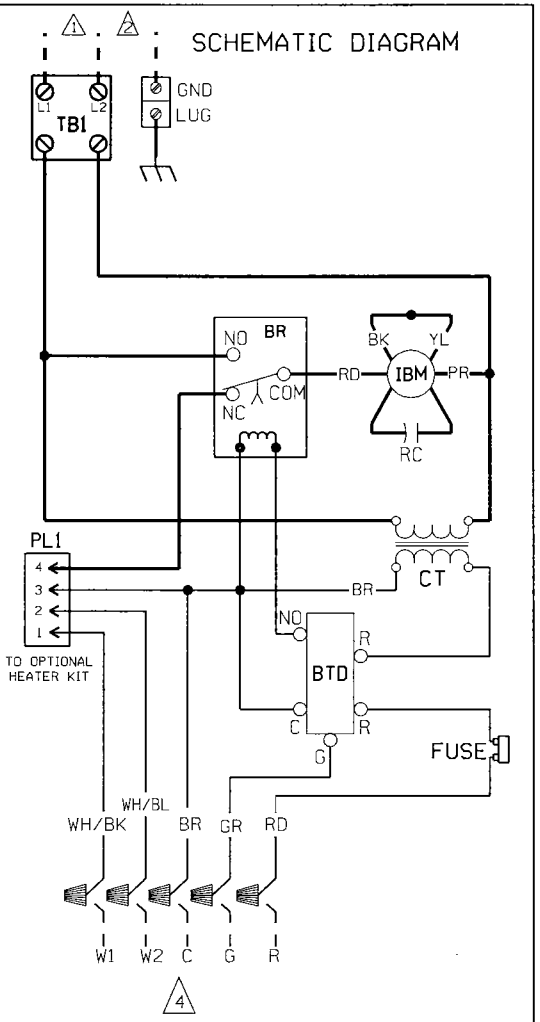

NOTES:

1. CONNECT SUPPLY WIRING TO 460V, 60HZ, THREE PHASE.
2. SUPPLY WIRE MUST BE RATED AT 75° C MIN. SEE INSTRUCTIONS FOR SIZE.
3. FOR USE WITH COPPER CONDUCTORS ONLY.
4. CONTROL WIRING TO THERMOSTAT.
5. FOR HIGH SPEED BLOWER:
   - REMOVE (RD) WIRE FROM COM TERMINAL OF BTD.
   - UNPLUG (BK) AND (YL) WIRES FROM MOTOR.
   - PLUG (BK) WIRE TO BTD RELAY COM TERMINAL.
   - LEAVE THE (YL) AND (RD) WIRE UNPLUGGED.
6. IBM FACTORY WIRED FOR LOW SPEED.

COMPONENT CODE

BTD	BLWR TIME DELAY
CB	CIRCUIT BREAKER
CT	CONTROL TRANSFORMER
IBM	INDOOR BLOWER MOTOR
OPT	OPTIONAL
PL	POLARIZED PLUG
RC	RUN CAPACITOR
BR	BLOWER RELAY

WIRING INFORMATION

LINE VOLTAGE
- -FACTORY STANDARD
- -FACTORY OPTION
- -FIELD INSTALLED

LOW VOLTAGE
- -FACTORY STANDARD
- -FACTORY OPTION
- -FIELD INSTALLED

REPLACEMENT WIRE
- -MUST BE THE SAME SIZE AND TYPE OF -INSULATION AS ORIGINAL (105° C MIN.)

WARNING
- -CABINET MUST BE PERMANENTLY GROUNDED AND CONFORM TO N.E.C., (C.E.C.-CANADA) AND LOCAL CODES.

WIRE COLOR CODE

BK	BLACK	PR	PURPLE
BR	BROWN	RD	RED
BL	BLUE	WH	WHITE
GR	GREEN	YL	YELLOW
OR	ORANGE		

WIRING DIAGRAM

ELECTRIC AIR HANDLER PSC MOTOR

DR. BY	APP. BY	DATE	DWG. NO.	REV
MGR	DJS	8-15-05	90-101950-01	01

DWG. NO. 90-101950-01 REV 01