

## WIRING DIAGRAM

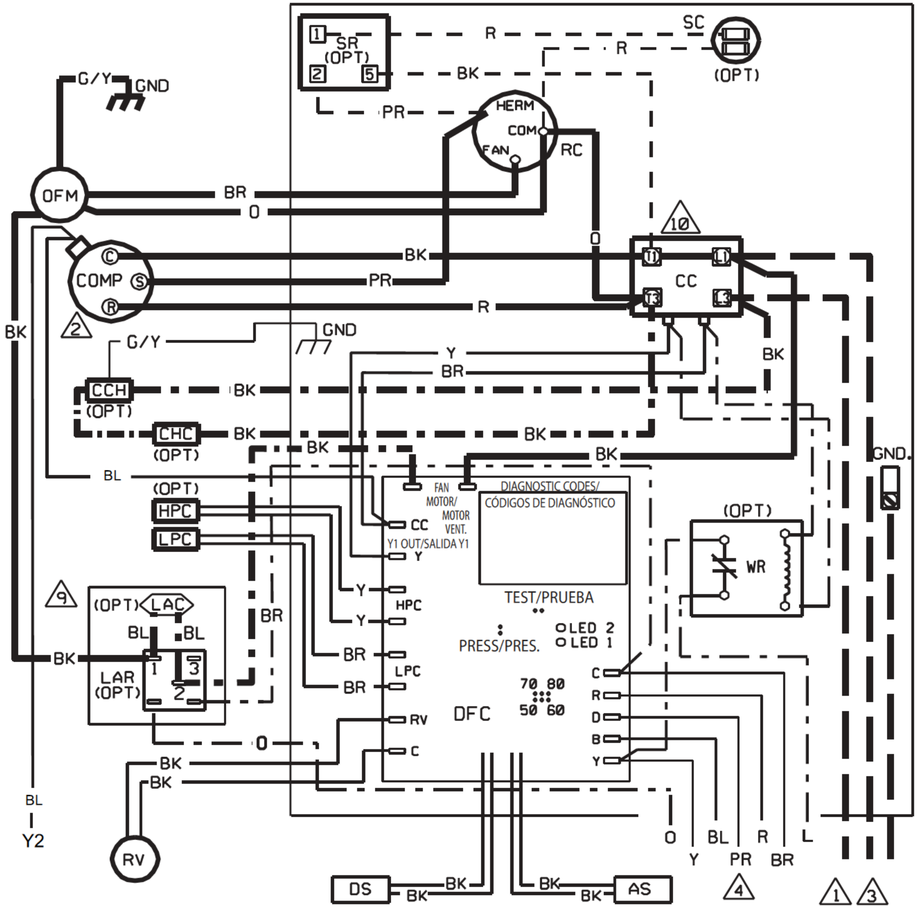


## WIRING SCHEMATIC

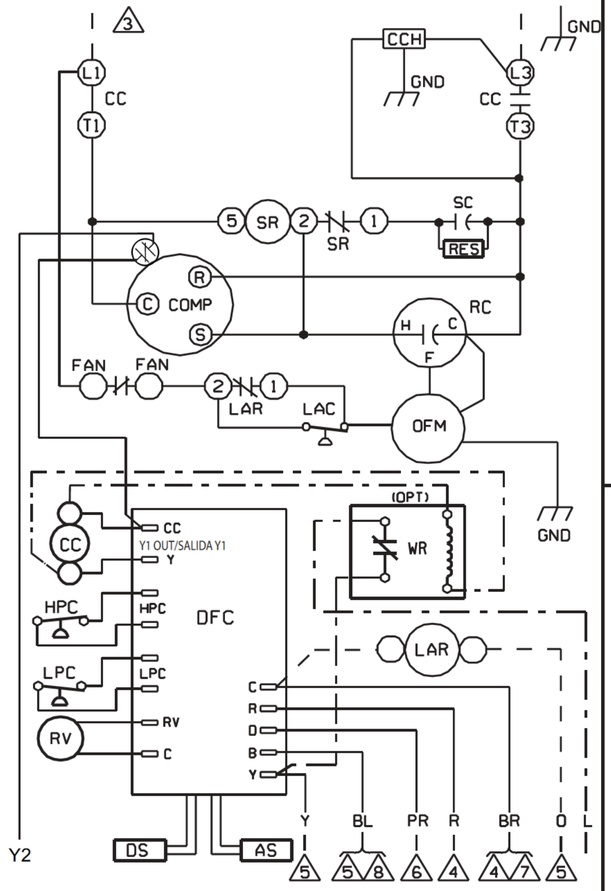


## COMPONENT CODE

| | |
|---|---|
| AS | AMBIENT SENSOR |
| CC | COMPRESSOR CONTACTOR |
| CCH | CRANKCASE HEATER |
| CHC | CRANKCASE HEATER CONTROL |
| COMP | COMPRESSOR |
| DFC | DEFROST CONTROL |
| DS | DEFROST COIL SENSOR |
| GND | GROUND, CHASSIS |
| HPC | HIGH PRES. CUT-OUT CONTROL |
| LAC | LOW AMBIENT COOLING CONTROL |
| LAR | LOW AMBIENT RELAY/RELÉ, |
| LPC | LOW PRESSURE CUT OUT CONTROL |
| OFM | OUTDOOR FAN MOTOR |
| OPT | OPTIONAL |
| RC | RUN CAPACITOR |
| RV | REVERSING VALVE |
| SC | START CAPACITOR |
| SR | START RELAY |
| WR | WARNING RELAY |

## NOTES:

1. CONNECTORS SUITABLE FOR USE WITH COPPER CONDUCTORS ONLY.
2. COMPRESSOR MOTOR THERMALLY PROTECTED AND ALL 3 PHASE ARE PROTECTED UNDER PRIMARY SINGLE PHASE CONDITIONS.
3. CONNECT FIELD WIRING IN GROUNDED RAINTIGHT CONDUIT TO 60 HERTZ FUSE DISCONNECT, VOLTAGE AND PHASE PER RATING PLATE.
4. LOW VOLTAGE CIRCUIT TO BE N.E.C. CLASS 2 WITH A CLASS 2 TRANSFORMER 24 VOLT, 60 HERTZ.
5. TO THERMOSTAT SUB-BASE, REFER TO SYSTEM SCHEMATICS OR SCHEMATICS ON INDOOR SECTION FOR LOW VOLTAGE CONTROL WIRING.
6. THIS WIRE IS USED TO TURN ON STRIP HEAT DURING DEFROST. OMIT CONNECTION FOR MOST ECONOMICAL OPERATIOIN.
7. TO HEAT PUMP MONITOR 2.5 VA. MAX. WHEN USED.
8. THIS COMPONENT IS ENERGIZED IN HEATING MODE.
9. IF LAC/LAR IS NOT USED, CONNECT BLACK WIRE FROM OFM TO OFC FAN MOTOR.
10. BLACK WIRE FROM SR (5) TO CC (T1) DELETED WHEN PTCR IS USED.

## WIRING INFORMATION/ INFORMACIÓN SOBRE CONEXIONADO

LINE VOLTAGE
-FACTORY STANDARD
-FACTORY OPTION
-FIELD INSTALLED

LOW VOLTAGE
-FACTORY STANDARD
-FACTORY OPTION
-FIELD INSTALLED

REPLACEMENT WIRE
-MUST BE THE SAME SIZE AND TYPE OF INSULATION AS ORIGINAL (105°C MIN.)

WARNING
-CABINET MUST BE PERMANENTLY GROUNDED AND CONFORM TO I.E.C., N.E.C., C.E.C. AND LOCAL CODES AS APPLICABLE.

## WIRE COLOR CODE

| | |
|---|---|
| BK _ _ BLACK | O _ _ _ ORANGE |
| BR _ _ BROWN | PR _ _ PURPLE |
| BL _ _ BLUE | R _ _ _ RED |
| G _ _ _ GREEN | W _ _ _ WHITE |
| GY _ _ GRAY | Y _ _ _ YELLOW |

## WIRING DIAGRAM

REMOTE HEAT PUMP
SINGLE PHASE WITH PSC
DEMAND DEFROST CONTROL
NON- COMMUNICATING TWO STAGE

| DR. BY | APP. BY | DATE | DWG. NO. | REV |
|---|---|---|---|---|
| JHB | | 2/9/17 | 90-101229-45 | 02 |